

22.2

# FLASHING TRANSITION - SHELF ANGLE WITH TERMINATION BAR

## SS ThruWall Flashing

Use **FastFlash** or **Joint & Seam Filler** to spot and cover the anchor bolts that attach the shelf angle to the structure. Allow product to skin over.

Place drip edge metal on the horizontal lenti/shelf angle. Secure the drip edge to the lenti/shelf angle by wet-setting the edge metal into wet **FastFlash** placed on the horizontal ledge of lenti/shelf angle. Install **SS ThruWall** flashing.

Apply a bead of **FastFlash** or **Joint & Seam Filler** along the top of the up leg of the **SS ThruWall** flashing. Wet-set the termination bar.

Mechanically fasten the termination bar.

Trade sequencing may make wet-setting impractical, and it is not required.

